Oxylog 2000
Technical Service Bulletin # 6

Re: **Device mount for vehicles P/N 84 12 069 (Accessory for Oxylog 2000)**

Update: May 22, 2000

Reference Doc: IDM nos. 6 / 02.99

Reason: It has been reported that both retaining pins in the device mount for vehicles P/N 84 12 069 may become loose. If the retaining pins loosen the Oxylog 2000 can fall down in worst case.

Solution: The two retaining pins (P/N 84 12 245) shall be secured with Loctite 221. Mark secured pins with screw stop varnish 3000 ISO red.

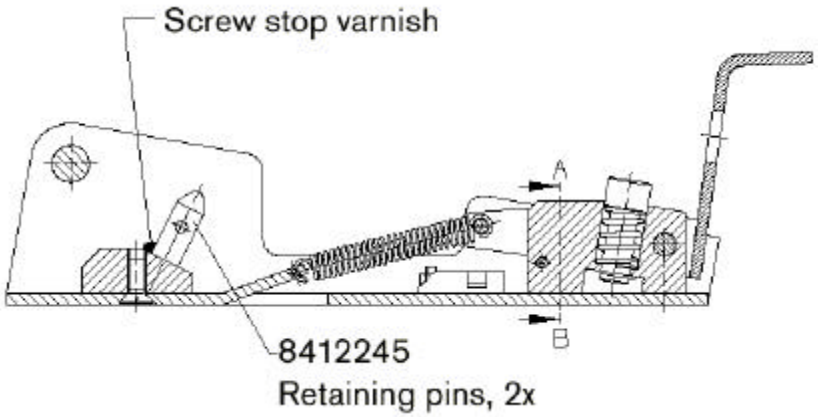

Devices affected: All device mounts for vehicles P/N 84 12 069 shipped prior February 1999.

When: Next Service Call or Preventive Maintenance.

Additional Info: N/A

Cost: Covered by Customer, post warranty.

Ordering Info:

Loctite 221, screw locking agent, low	P/N 79 01 966
Screw stop varnish 3000 ISO red	P/N 79 01 616

Distribution: Dräger Service Personnel and Authorized Service Organizations for CCS products.

If you have any questions, please contact Technical Support by phone at 1-800-543-5047 or by fax at 1-215-721-5789

Dräger Medical, Inc.
Technical Product Manager